


<b>Cartridge:</b>	HP94 C8765W HP96 C8767W HP98 C9364WN	<b>Cartridge Wt. New:</b>	Approx 38g Approx 48g
<b>OEM:</b>	Hewlett Packard	<b>Printer:</b>	Photosmart 325,375,2610,2710,8150, 8450 Psc2355, Deskjet 5740,6540,6840
<b>Printhead Location:</b>	Cartridge	<b>Cartridge Type:</b>	Sponge
<b>Reliability:</b>	**	<b>Skill Level:</b>	Average

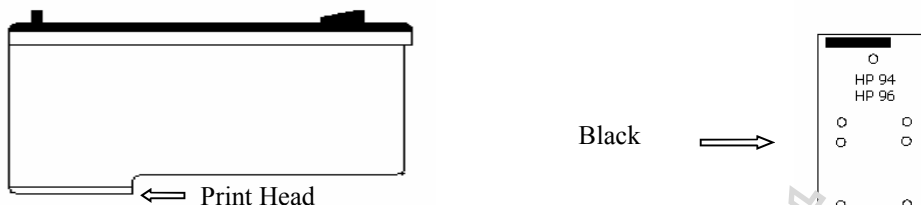

© Ausjet Ink Jet Supplies and Service Pty Ltd

Fig. 2.63

## COMMENTS

Be careful not to tear the label so you can reuse it. The low volume 92 cartridge can be refilled to the volume of the high volume 94 cartridge. The HP 98 holds 10ml of ink.

## REQUIREMENTS

- ◆ 1 x 20 ml syringes and sharp needles.
- ◆ 18 ml of appropriate black Ink.
- ◆ Head sealing tape and or cartridge clip.
- ◆ HSC1000 solution or steam for improved results.

## REFILLING METHOD

**Step 1.** Soak print head in HSC1000 for 10-20 mins or gently apply steam directly to printhead to remove dried ink from the print head nozzles.

**Step 2.** Put the cartridge on some paper towels in an area where you can tolerate a spill.

**Step 3.** Peel off the top label.

**Step 4.** Fill the syringe with 18ml. of appropriate black ink. When the cartridge is new it holds 21ml.

**Step 5.** Very S-L-O-W-L-Y inject ink into a chamber until the sponge is full. A little ink might come out of the top when full. If the cartridge is overfilled, draw some ink back with the syringe.

**Step 6.** When finished, replace the top label.

**Step 7.** Then do a DAB test.

**Step 8.** Replace the cartridge and run 1 - 3 cleaning cycles as per printer instructions.