


| | | | |
|----------------------------|--------------------------------|---------------------------|---|
| Cartridge: | BC-05, BC-06, BC-09 | Cartridge Wt. New: | Approx 57 g |
| OEM: | Canon | Printer: | BJC-210, BJC-210SP BJC-240, BJC-255SP BJC-265SP, BJC-1000SP |
| Printhead Location: | Cartridge | Cartridge Type: | Sponge |
| Reliability: | * * * | Skill Level: | Average |

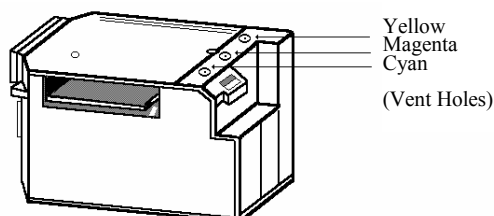

© Ausjet Ink Jet Supplies and Service Pty Ltd

Fig. 2.13

COMMENTS

The BC-05 and BC-06 are tri-colour cartridges, identical in appearance to the black BC-02 cartridge except for the grey casing. The BC-06 uses photo inks and is not found the earlier model Canon printers such as the 210 series. The BC-09 uses fluorescent inks.

REQUIREMENTS

- ◆ BC-05,BC-06, BC-09: 0-7 ml each Appropriate Cyan, Magenta, Yellow Inks.
(Refer to Ausjet Ink Selector)
- ◆ 3 x 10 ml syringes with 18g sharp needles
- ◆ Plug removal tool
- ◆ HSC1000 solution or steam for improved results.
- ◆ Print head sealing tape and or print head clip.

REFILLING METHOD

STEP 1.

Soak the print head in HSC1000 for 10-20mins or gently apply steam direct to printhead. Remove the three plugs shown in the diagram. A simple method of removing a plug is to partially drill a small screw into the small vent hole. Once it catches the screw may be pulled out taking the plug with it.

STEP 2.

Attach the 18 gauge needle to your syringe and draw up 7 ml of ink of the appropriate type and in the appropriate colour. Use a different syringe for each colour. Insert the syringe into the appropriate plug hole as far as it will go and inject the ink slowly. Lift upwards as you inject taking care not to overfill as the cartridge may not be completely empty when you begin. If ink bubbles to the top draw back on the syringe slightly to withdraw some of the ink. Repeat for the remaining two colours.

STEP 3.

Replace the plugs into the vent holes.