


<b>Cartridge:</b>	<b>HP51605/04</b>	<b>Cartridge Wt. New:</b>	Approx 12g
<b>OEM:</b>	<b>Hewlett Packard</b>	<b>Printer:</b>	Thinkjet
<b>Printhead Location:</b>	Cartridge	<b>Cartridge Type:</b>	Reservoir
<b>Reliability:</b>	*	<b>Skill Level:</b>	Average

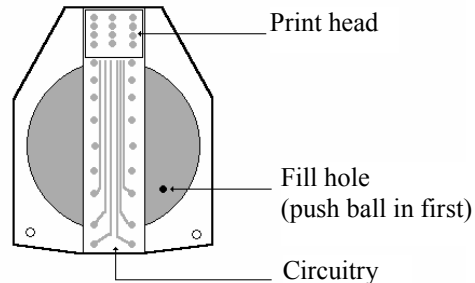

© Ausjet Ink Jet Supplies and Service Pty Ltd

Fig. 2.61

## COMMENTS

This is not an ideal cartridge from a recycler's point of view. Not very successful, they can leak during transportation. Print quality is awful.

## REQUIREMENTS

- ◆ 5-7 ml Appropriate Black Ink
- ◆ 5 ml syringe with blunt needle
- ◆ Small ball plug
- ◆ Blue tape
- ◆ HSC1000 high speed cleaning solution or steam

## REFILLING METHOD

### STEP 1.

Soak the print head in HSC1000 for 10-20 mins or gently apply steam direct to the printhead to remove dried ink from the print head nozzles.

### STEP 2.

Using a ball point pen push the ball into the cartridge. (See Fig. 2.56).

### STEP 3.

Attach the needle to the syringe and draw up 7 ml of ink. Insert the needle into the cartridge. Do not insert the needle too deeply or the black rubber bladder which houses the ink may be punctured. Inject the ink slowly and then place the plug firmly into the cartridge.