
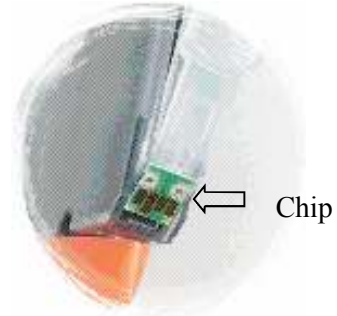


<b>Cartridge:</b>	<b>CLI-8 PGI-5</b>	<b>Cartridge Wt. New:</b>	CLI-8 Approx 26 g PGI-5 Approx 39 g
<b>OEM:</b>	<b>Canon</b>	<b>Printer:</b>	
<b>Printhead Location:</b>	In printer	<b>Cartridge Type:</b>	Sponge
<b>Reliability:</b>	*	<b>Skill Level:</b>	Average

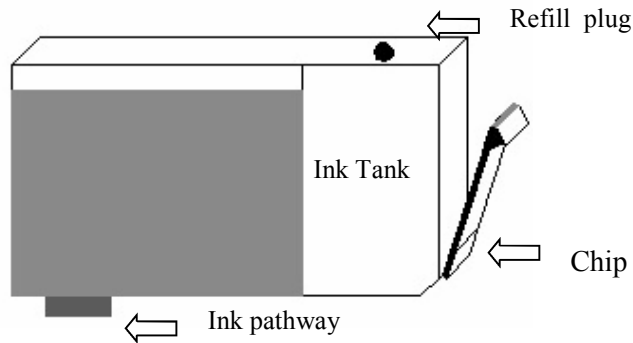

## COMMENTS

This cartridge contains a sponge in one side of the cartridge and a void on the other side. Make sure that you make the seal airtight or the cartridge will leak. A Ausjet reusable BCI-3 plug is perfect for sealing this cartridge. The black cartridge uses a pigment ink. To refill this cartridge you will be asked to disable the ink level gauge for printing to continue. This could cause the Printhead to burn out due to lack of ink. Please be aware that by following these refilling instructions you are accepting sole risk for the refilling procedure and any potential resultant damage to the printer or failure by Canon to honour any warranty. Ausjet Inkjet Supplies hereby disclaim all responsibility.

## REQUIREMENTS

- ◆ 10ml syringes and sharp needles.
- ◆ Approx 13ml of appropriate black Ink for the CLI-8 cartridge.
- ◆ Approx 26 ml of appropriate black ink for the PGI-5
- ◆ Reusable plugs
- ◆ Sealing tape and or cartridge clip.

## REFILLING METHOD

**Step 1.** Put the cartridge on some paper towels in an area where you can tolerate a spill.

**Step 2.** If this is the first time the cartridge has been filled you may find it difficult to push in the ball plug. We found that it was easier to gently place the cartridge in a vice to hold it steady and then use a nail punch and a hammer to push the ball into the chamber. You could also stand the cartridge on a bench and push the ball in with the nail punch. Make sure not to damage the seat that holds the ball in place. The hole needs to be the same size hole to allow the BCI-3 reusable plug to fit.

**Step 3.** Place a cartridge clip or tape over the ink path hole.

**Step 4.** Fill the syringe with 13ml of appropriate black ink for the CLI-8 or 26 ml of ink for the PGI-5 cartridge.

**Step 5.** Very S-L-O-W-L-Y inject ink into a chamber until the correct amount of ink is inserted or the ink tank is full. A little ink might come out of the top when full. If the cartridge is overfilled, draw some ink back with the syringe.

**Step 6.** When cartridge is full insert a reusable plug. And allow to sit for a few minutes, if necessary top up the ink tank.

**Step 7.** Replace the cartridge and run 1 - 3 cleaning cycles as per printer instructions.